3

DWG NO REV. CNS002-I

21604

40648

ZONE REV.

C3

**B4** 

- N/C NEW RELEASE

DATE


12/20/04

7/16/18

APPROVED

DEK

This print and associated documents and the contained Information are the confidential property of ELECTRONIC CABLE SPECIALISTS. Disclosure of, and/or reproduction of, all or part thereof or manufacture of any part from information contained on this print not specifically per-mitted by ELECTRONIC CABLE SPECIALISTS in writing is forbidden.

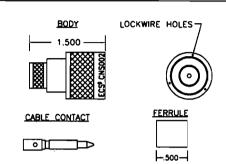

## **SPECIFICATIONS**

D

**ELECTRICAL** IMPEDANCE: 50 OHMS NOMINAL FREQUENCY RANGE: 0-11 GHz VSWR: 1.2:1 MAXIMUM DC TO 2GHz INSERTION LOSS: .1dB MAXIMUM DC TO 2GHz WORKING VOLTAGE: 1000 VRMS SEA LEVEL DIELECTRIC WITHSTANDING: 2500 VRMS . SEA LEVEL INSULATION RESISTANCE: 5000 MEGOHMS MINIMUM

DIMENSIONS 3

• 500 VOLTS DC

CONNECTOR INTERFACE: DIMENSIONS PER MIL-STD-348A FIGURE 304-1 (N)

TERMINATION STYLE: CENTER CONTACT-SOLDER ONLY FERRULE-CRIMP

CABLE RETENTION: 60 LBS

TEMPERATURE RATING: -65' TO +165' C VIBRATION: MIL-STD-202, METHOD 204, COND. B SHOCK: MIL-STD-202, METHOD 213, COND. I THERMAL SHOCK: MIL-STD-202, METHOD 107, COND. B CORROSION: MIL-STD-202, METHOD 101, COND. B MOISTURE RESISTANCE: MIL-STD-202, METHOD 106

BODY: BRASS PER QQ-B-626 FERRULE: ANNEALED BRASS PER QQ-B-626 CENTER CONTACT: BRASS PER QQ-B-626 OUTER CONTACT: BRASS PER QQ-B-626 DIELECTRIC: TEFLON PER L-P-403 GASKET: SILICONE RUBBER PER ZZ-R-765

BODY, FERRULE AND OUTER CONTACT: BRIGHT NICKEL PER QQ-N-290

CENTER CONTACT: GOLD PER MIL-G-45204

## INSTALLATION INSTRUCTIONS


1. BEGIN BY CUTTING THE CABLE OFF SQUARE.



2. WHEN USING AUTOMATIC STRIPPING EQUIPMENT, STRIP CABLE AS SHOWN STARTING WITH L1 AND ENDING WITH L3. TAKE CARE NOT TO NICK THE CONDUCTORS WHILE STRIPPING THE DIELECTRIC AND JACKET. IF AUTOMATIC STRIPPING EQUIPMENT IS NOT AVAILABLE, STRIP ONLY L1 AND L3 AND TRIM EXCESS BRAID AT STEP 10.



3. SLIDE THE FERRULE AND ADHESIVE SHRINK TUBING OVER THE END OF THE CABLE. 1



4. SOLDER THE CONTACT ONTO THE CENTER CONDUCTOR, PER MIL-STD-2000, USING 63Sn/37Pb SOLDER. ENSURE THE CONTACT IS BUTTED AGAINST THE CABLE DIELECTRIC, CLEAN ALL FLUX RESIDUES USING AN APPROPRIATE FLUX CLEANER.




5. USING TWEEZERS, FOLD THE OUTER BRAID BACK OVER THE CABLE JACKET, LEAVING AS MUCH WEAVE AS POSSIBLE.



6. SLICE THE ALUMINUM/POLYESTER FOIL LENGTHWISE ABOUT EVERY 1/8". GENTLY ROTATE PIN TO SEPARATE THE FLAT FOIL BRAID AND ALUMINUM/POLYESTER FOIL FROM THE DIELECTRIC. USING TWEEZERS, FOLD BACK ALUMINUM/POLYESTER FOIL OVER THE OUTER BRAID.



USING TWEEZERS, FOLD THE INNER BRAID BACK OVER THE OTHER SHIELDS, LEAVING AS MUCH WEAVE AS POSSIBLE. NOTE: DO NOT UNRAVEL DIELECTRIC WHEN PULLING BACK INNER SHIELD.




8. SLIDE THE BODY OF THE CONNECTOR OVER THE END OF THE CABLE UNTIL THE NOTCH IN THE CONTACT SEATS INTO THE DIELECTRIC RIDGE INSIDE THE CONNECTOR BODY.

DESCRIPTION


A NOTE 4 DEL "OR CRIMP WITH Y1757 DIE"

TERM STYLE SPEC. DELETED "CRIMP"


REVISIONS



9. FOLD ALL THREE BRAIDS UP OVER THE NECK OF THE CONNECTOR BODY.



10. SLIDE THE FERRULE UP OVER THE SHIELDS AND UP AGAINST THE CONNECTOR BODY. TRIM AWAY ANY EXCESS BRAID. CRIMP THE FERRULE ONCE, NEXT TO THE BODY, USING THE M22520/5-31 DIE IN A M22520/5-01 TOOL FRAME. APPLY ADHESIVE HEAT SHRINK, /2



NOTES

INSURE HEAT SHRINK IS INSTALLED PRIOR TO CRIMPING CONNECTOR.

ADHESIVE HEAT SHRINK SHOULD BE APPLIED IN ACCORDANCE WITH ECS WORK INSTRUCTION WIGO7, CONTACT ECS FOR A COPY OF THIS WORK INSTRUCTION.

/3\ CONNECTOR DIMENSIONS ARE FOR REFERENCE ONLY.

ALL LENGTHS IN INCHES		ELECTRONIC CABLE SPECIALISTS FRANKLIN, WI 53132 ECS PHONE: (414) 421-5300					
APPROVALS	DATE	TITLE		-			
DRAWN BY: C CHAPMAN	12/14/04	CUSTOMER SPECIFICATION					
CHECKED BY: D KNOLL	12/20/04	STRAIGHT N TYPE PLUG FOR ECS CABLE 310701					
DESIGNED BY:		SIZE	CAGE CODE	$\neg$	LEVEL	PART NO.	
PROJECT ENG:		B	6619	71		CNS002	
ENG. MGR:				۰			
D KNOLL	12/20/04	SCALE:			FILE NO F:\E\SPEC\CONN\INST\CNS002 SHEET: 1 OF 1		